CROSSFIELD PRODUCTS CORPORATION

www.crossfieldproducts.com

3000 E. Harcourt St. 140 Valley Rd.

Rancho Dominguez, CA 90221 (Headquarters)

Roselle Park, NJ 07204

(310)-886-9100 (8:00 AM – 5:00 PM Pacific Time) (908)-245-2800 (8:00 AM – 5:00 PM Eastern Time)

SAFETY DATA SHEET

1. PRODUCT IDENTIFICATION

TRADE NAME (AS LABELED): MiraPrime MP Part B

CHEMICAL NAME/CLASS: Polyamine Solution

PRODUCT USE: Specialty Flooring Basecoat Curative

SUPPLIER/MANUFACTURER'S NAME: Crossfield Products Corp.

ADDRESS: (West Coast): 3000 E. Harcourt St.

Rancho Dominguez, CA 90221 (Headquarters)

ADDRESS: (East Coast): 140 Valley Rd.

Roselle Park, NJ 07204

EMERGENCY PHONE: CHEMTREC: 800-424-9300

<u>DATE OF PREPARATION</u>: May 1, 2024 <u>REVISION DATE</u>: May 1, 2024

2. HAZARD(S) IDENTIFICATION

GHS Classification

Acute toxicity: dermal - Category 4 Skin corrosion/irritation - Category 1B

Respiratory Sensitization – Category 1 Skin sensitization – Category 1

Reproductive toxicity: fertility – Category 2 Reproductive toxicity: unborn child – Category 2

Serious eye damage/eye irritation - Category 1

Specific Target Organ Toxicity (Single Exposure):

Specific Target Organ Toxicity (Repeated exposure): skin,

eyes, mucous membranes - Category 1

respiratory tract, kidneys, liver - Category 1







Signal Word: (Danger)

Hazard Statements:

H312: Harmful in contact with skin.

H314 Causes severe skin burns and eye damage

H317: May cause an allergic skin reaction.

H361d: Suspected of damaging the unborn child

H361f: Suspected of damaging fertility

H334: May cause allergy or asthma symptoms or breathing difficulties if inhaled.

H370: Causes damage to organs: (eyes, mucous membranes)

H372: Causes damage to organs through prolonged or repeated exposure: (skin, respiratory tract, kidneys, liver)

Precautionary Statements:

P102: Keep out of reach of children

P202: Do not handle until all safety precautions have been read and understood.

P260 Do not breathe dust/fume/gas/mist/vapors/spray

P264: Wash hands thoroughly after handling.

P270: Do not eat drink or smoke when using this product.

P272: Contaminated work clothing should not be allowed out of the workplace.

P280: Wear protective gloves/protective clothing/eye protection/face protection

P281: Use personal protective equipment as required.

P285: In case of inadequate ventilation wear respiratory protection.

P501: Dispose of contents and container in accordance with all local, regional, national and international regulations.

MiraPrime MP Part B (7566), SDS

MiraPrime MP Part B (7566)

P314: Get medical attention if you feel unwell.

P307+P311: IF exposed: Call a POISON CENTER or physician.

P304+P340+P310: IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing.

Immediately call a POISON CENTER or physician.. Rinse mouth. Do NOT induce vomiting.

P342+P311: If experiencing respiratory symptoms: Call a POISON CENTER or physician.

P301+P310+P330+P331: IF SWALLOWED: Immediately call a POISON CENTER or physician. Rinse mouth. Do NOT induce vomiting.

P303+P361+P353+P363+P310: IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water or shower. Wash contaminated clothing before reuse. Immediately call a POISON CENTER or physician.

P302+P352+P312: IF ON SKIN: Wash with plenty of soap and water. Call a POISON CENTER or physician if you feel unwell.

P333+P313: If skin irritation or rash occurs: Get medical attention.

P305+P351: IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a POISON CENTER or physician.

P501: Dispose of contents and container in accordance with all local, regional, national and international regulations.

HMIS-RATINGS (SCALE 0 - 4)



NFPA RATING

Health = 3 Fire = 1 Reactivity = 0



3. COMPOSITION / INFORMATION ON INGREDIENTS

CHEMICAL NAME	CAS#	%	EXPOSURE LIMITS IN AIR					
		w/w	ACGIH		OSHA			
			TLV	STEL	PEL	STEL	IDLH	OTHER
			mg/m³	mg/m³	mg/m ³	mg/m ³	mg/m ³	mg/m³
Polymer of c-18 unsat'd fatty acid dimmers w/ teta and tofa	68082-29-1	40 - 70	NE	NE	NE	NE	NE	NE
Triethylenetetramine	112-24-3	3 – 7	NE	NE	NE	NE	NE	Note 1
Fatty acids, tall-oil, reaction products with tetraethylenepentamine	68953-36-6	10 – 30	NE	NE	NE	NE	NE	NE
Tetraethylenepentamine	112-57-2	3 - 7	NE	NE	NE	NE	NE	NE
Tris-2,4,6-(dimethylaminomethyl)phenol	90-72-2	< 5	NE	NE	NE	NE	NE	NE
Bis(dimethylaminomethyl)phenol	71074-89-0	< 1	NE	NE	NE	NE	NE	NE
Water and other ingredients. The other ingredients are each present in less than 1 percent concentration in this product.			The components present in the balance of this product do not contribute any significant, additional hazards. All hazard information pertinent to this product has been presented in the remaining sections of this Material Safety Data Sheet, per the requirements of Federal Occupational Safety and Health Hazard Communication Standard (29 CFR 1910.1200).					
VOC: Component = 0 G		As Applied – 74 Grams/Liter (Part of Multi-Component System)						

Note 1: TWA 1 ppm, WEEL 6 mg/m³

NE = Not Established. C = Ceiling Limit. See Section 16 for Definitions of Terms Used.

NOTE: All WHMIS required information is included. It is located in appropriate sections based on the ANSI Z400.1-1993 format.

4. FIRST-AID MEASURES

SKIN EXPOSURE: Get medical attention immediately. Call a poison center or physician. Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Chemical burns must be treated promptly by a physician. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clear shoes thoroughly before reuse.

<u>EYE EXPOSURE</u>: Get medical attention immediately. Call a poison center or physician. Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Chemical burns must be promptly by a physician.

<u>INHALATION</u>: Get medical attention immediately. Call a poison center or physician. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband. In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours. In the event of any complaints or symptoms, avoid further exposure.

INGESTION: Get medical attention immediately. Call a poison center or physician. Wash out mouth with water. Remove dentures if any. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Chemical burns must be treated promptly by a physician. Never give anything by mouth to an unconscious person. If unconscious, place in a recovery position and get medical attention immediately. Maintain an open airway Loosen thigh clothing such as a collar tie, belt or waistband.

5. FIRE-FIGHTING MEASURES


FLASH POINT, °C (method): >93°C (205°F) Closed Cup

AUTOIGNITION TEMPERATURE, °C: ND FLAMMABLE LIMITS (in air by volume, %):

FIRE EXTINGUISHING MATERIALS:

Water Spray: YES Foam: YES Halon: ND Lower (LEL): NE Upper (UEL): NE

<u>Carbon Dioxide</u>: YES <u>Dry Chemical</u>: YES <u>Other</u>: Any "ABC" Class.

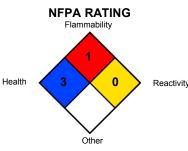

<u>UNUSUAL FIRE AND EXPLOSION HAZARDS</u>: Run-off from fire control may cause pollution. Keep fire-exposed containers cool with water spray to prevent rupture due to excessive heat. High pressure water hose may spread product from broken containers increasing contamination. If involved in a fire, this product may decompose to produce a variety of compounds (i.e. carbon monoxide, carbon dioxide, aldehydes, nitrogen oxides and compounds). Emergency responders must wear the proper personal protective equipment suitable for the situation to which they are responding. Products of combustion are irritating to the respiratory tract and may cause breathing difficulty. Symptoms may be delayed several hours or longer depending upon the extent of exposure.

<u>Explosion Sensitivity to Mechanical Impact</u>: Not sensitive. <u>Explosion Sensitivity to Static Discharge</u>: Not sensitive.

<u>SPECIAL FIRE-FIGHTING PROCEDURES</u>: Incipient fire responders should wear eye protection. Structural fire fighters must wear Self-Contained Breathing Apparatus and full protective equipment. Move fire-exposed containers, if it can be done without risk to firefighters. If possible, prevent run-off water from entering storm drains, bodies of water, or other environmentally sensitive areas. If necessary, discard or decontaminate fire response equipment before returning such equipment to service.

6. ACCIDENTAL RELEASE MEASURES

<u>SPILL AND LEAK RESPONSE</u>: Uncontrolled releases should be responded to by trained personnel using pre-planned procedures. Proper protective equipment should be used. In case of a spill, clear the affected area, protect people, and respond with trained personnel.

The proper personal protective equipment for incidental releases (e.g.-1 L of the product released in a well-ventilated area) use impermeable gloves, specific for the material handled, goggles, face shield, and appropriate body protection. In the event of a large release, use impermeable gloves, specific for the material handled, chemically resistant suit and boots, and hard-hat. Self Contained Breathing Apparatus or respirator may be required where engineering controls are not adequate or conditions for potential exposure exist. When respirators are required, Select NIOSH/MSHA approved based on actual or potential airborne concentrations in accordance with latest OSHA and/or ANSI recommendations. Absorb spilled liquid with polypads or other suitable absorbent materials. Neutralize residue with sodium bicarbonate and water rinse. Decontaminate the area thoroughly. Test area with litmus paper to confirm neutralization. Place all spill residue in a suitable container. Dispose of in accordance with Federal, State, and local hazardous waste disposal regulations (see Section 13, Disposal Considerations).

7. HANDLING and STORAGE

WORK PRACTICES AND HYGIENE PRACTICES: As with all chemicals, avoid getting this product ON YOU or IN YOU. Wash hands after handling this product. Do not eat or drink while handling this material. Remove contaminated clothing immediately. Discard contaminated clothing items, or launder before re-use. Inform anyone handling such contaminated laundry of the hazards associated with this product. Use ventilation and other engineering controls to minimize potential exposure to this product.

STORAGE AND HANDLING PRACTICES: All employees who handle this material should be trained to handle it safely. Avoid breathing mists or sprays generated by this product. Use in a well-ventilated location.

For Non-Bulk Containers: Open containers slowly, on a stable surface. Containers of this product must be properly labeled. Store containers in a cool, dry location, away from direct sunlight, sources of intense heat, or where freezing is possible. Material should be stored in secondary containers, or in a diked area, as appropriate. Store containers away from incompatible chemicals. Keep container tightly closed when not in use. Wash thoroughly after using this material. Storage areas should be made of fire-resistant materials. If appropriate, post warning signs in storage and use areas. Inspect all incoming containers before storage, to ensure containers are properly labeled and not damaged. Empty containers may contain residual liquid, therefore, empty containers should be handled with care.

Bulk Containers: All tanks and pipelines which contain this material must be labeled. Perform routine maintenance on tanks or pipelines which contain this product. Report all leaks immediately to the proper personnel.

Tank Car Shipments: Tank cars carrying this product should be loaded and unloaded in strict accordance with tank-car manufacturer's recommendation and all established on-site safety procedures. Appropriate personal protective equipment must be used (see Section 8, Engineering Controls and Personal Protective Equipment.). All loading and unloading equipment must be inspected, prior to each use. Loading and unloading operations must be attended, at all times. Tank cars must be level, brakes must be set or wheels must be locked or blocked prior to loading or unloading. Tank car (for loading) or storage tank (for unloading) must be verified to be correct for receiving this product and be properly prepared, prior to starting the transfer operations. Hoses must be verified to be clean and free of incompatible chemicals, prior to connection to the tank car or vessel. Valves and hoses must be verified to be in the correct positions, before starting transfer operations. A sample (if required) must be taken and verified (if required) prior to starting transfer operations. All lines must be blown-down and purged before disconnecting them from the tank car or vessel.

PROTECTIVE PRACTICES DURING MAINTENANCE OF CONTAMINATED EQUIPMENT: Follow practices indicated in Section 6 (Accidental Release Measures). Make certain application equipment is locked and tagged-out safely. Always use this product in areas where adequate ventilation is provided. Decontaminate equipment before maintenance begins by a triple-rinse with water followed, if necessary, by using sodium bicarbonate and an additional rinse. Collect all rinsates and dispose of according to applicable Federal, State, or local procedures.

8. EXPOSURE CONTROL/PERSONAL PROTECTION

<u>VENTILATION AND ENGINEERING CONTROLS</u>: If required use a corrosion-resistant ventilation system separate from other exhaust ventilation systems to ensure that there is no potential for overexposure to sprays, or mists of this product and that exposures are below those in section 2 (Composition and Information on Ingredients). Ensure eyewash/safety shower stations are available near areas where this product is used.

RESPIRATORY PROTECTION: Maintain airborne contaminant concentrations below exposure limits listed in Section 2 (Composition and Information on Ingredients). If respiratory protection is needed, use only protection authorized in 29 CFR 1910.134, or applicable State regulations. If adequate ventilation is not available or if there is potential for airborne exposure above the exposure limits (listed in Section 2) a respirator may be worn up to respirator exposure limitations, check with respirator equipment manufactures recommendations/limitations. For a higher level of protection use positive pressure supplied air respiration protection or Self Contained Breathing Apparatus or if oxygen levels are below 19.5% or are unknown.

EMERGENCY OR PLANNED ENTRY INTO UNKNOWN CONCENTRATIONS OR IDLH CONDITIONS:

Positive pressure, full-facepiece Self Contained Breathing Apparatus; or positive pressure, full-facepiece Self Contained Breathing Apparatus with an auxiliary positive pressure Self Contained Breathing Apparatus.

<u>EYE PROTECTION</u>: Splash goggles or safety glasses. Face-shields are recommended when the operation can generate splashes, sprays or mists.

<u>HAND PROTECTION</u>: Wear appropriate gloves for routine industrial use. Use appropriate gloves for spill response, as stated in Section 6 of this MSDS (Accidental Release Measures).

<u>BODY PROTECTION</u>: Use body protection appropriate for task. Cover-all, rubber aprons, or chemical protective clothing made from natural rubber are generally acceptable, depending upon the task.



Vapor Respirator



Safety Glasses



Safety Gloves

pH: >7 (Alkaline)

EVAPORATION RATE (n-BuAc=1): ND

BOILING POINT: Not established

MELTING/FREEZING POINT: Not established.



Synthetic Apron

9. PHYSICAL and CHEMICAL PROPERTIES

RELATIVE VAPOR DENSITY (air = 1): ND SPECIFIC GRAVITY (water = 1): 0.97 SOLUBILITY IN WATER: Slightly soluble. VAPOR PRESSURE, mm Hg @ 21 °C: ND

ODOR: Amine

LOG WATER/OIL DISTRIBUTION COEFFICIENT: Not available.

APPEARANCE AND COLOR: This product is an amber liquid solution

HOW TO DETECT THIS SUBSTANCE (warning properties): Litmus paper will turn blue upon contact with this solution

10. STABILITY and REACTIVITY

STABILITY: Stable.

<u>DECOMPOSITION PRODUCTS</u>: Thermal decomposition products of this solution can include a variety of compounds. (i.e. carbon monoxide, carbon dioxide, aldehydes, nitrogen oxides and other compounds).

MATERIALS WITH WHICH SUBSTANCE IS INCOMPATIBLE: This product reacts with strong oxidizers and acids

HAZARDOUS POLYMERIZATION: Will not occur by itself. Considerable exothermic reaction with epoxy resins is possible.

<u>CONDITIONS TO AVOID</u>: Avoid exposure or contact to extreme temperatures and incompatible chemicals i.e. mineral acids, organic acids, oxidizing agents and reactive metals.

11. TOXICALOGICAL INFORMATION

TOXICITY DATA: Additional toxicology information for components greater than 1 percent in concentration is provided below.

68082-29-1/112-24-3

(Rat) > 2,000 mg/kg - estimated

68953-36-6/112-57-2/68991-84-4 > 2,000 mg/kg – estimated 90-72-2/71074-89-0 (Rat) 1,670 mg/kg

Acute Inhalation Toxicity (LC50): ND

ND

ND

Skin Irritation (LD50):

Acute Oral Effects (LD50):

(Rabbit) >2,000 mg/kg - estimated

400 - 2,000 mg/kg - estimated

(Rabbit) 1,400 mg/kg

Eye Irritation:

Moderate eye irritation

Severe eye irritation

Acute dermal irritation

Moderate skin irritation

Severe skin irritation

Sensitization

May be caused by skin contact.

Sensitization has been seen in humans

<u>SUSPECTED CANCER AGENT</u>: The major components of this product are not found on the following lists: FEDERAL OSHA Z LIST, NTP, IARC, CAL/OSHA; and are therefore not considered to be, nor suspected to be, cancer-causing agents by these agencies.

IRRITANCY OF PRODUCT: This product is severely irritating and corrosive to contaminated tissue.

<u>SENSITIZATION TO THE PRODUCT</u>: Prolonged or repeated skin contact can result in the development of rashes, and other allergy-like symptoms.

<u>REPRODUCTIVE TOXICITY INFORMATION</u>: Listed below is information concerning the effects of this product and its components on the human reproductive system.

Mutagenicity: This product is not reported to produce mutagenic effects in humans.

Embryotoxicity: This product is not reported to produce embryotoxic effects in humans.

Teratogenicity: This product is not reported to cause teratogenic effects in humans.

Reproductive Toxicity: This product is not reported to cause reproductive effects in humans.

A <u>mutagen</u> is a chemical which causes permanent changes to genetic material (DNA) such that the changes will propagate through generational lines. An <u>embryotoxin</u> is a chemical which causes damage to a developing embryo (i.e. within the first eight weeks of pregnancy in humans), but the damage does not propagate across generational lines. A <u>teratogen</u> is a chemical which causes damage to a developing fetus, but the damage does not propagate across generational lines. A <u>reproductive toxin</u> is any substance which interferes in any way with the reproductive process.

BIOLOGICAL EXPOSURE INDICES: Currently there are no Biological Exposure Indices (BEIs) associated with the components of this product.

MEDICAL CONDITIONS AGGRAVATED BY EXPOSURE Skin disorders can be aggravated by over-exposure to this product. Inhalation of this products mists may aggravate respiratory conditions.

RECOMMENDATIONS TO PHYSICIANS: Treat symptoms and eliminate over-exposure to this product.

12. ECOLOGICAL INFORMATION

ALL WORK PRACTICES MUST BE AIMED AT ELIMINATING ENVIRONMENTAL CONTAMINATION

CAS No. 90-72-2/71074-89-0

Toxicity to Fish LC50 (24 hr): 222 mg/l Rainbow trout (Onocorhynchus mykiss)

LC100 (96 hr): 240 mg/l Rainbow trout (Onocorhynchus mykiss) LC0 (96 hr): 180 mg/l Rainbow trout (Onocorhynchus mykiss)

LC50 (24 hr): 249 mg/l Carp (Cyprinus carpio) LC50 (96 hr): 175 mg/l Carp (Cyprinus carpio) EC50 (96 hr): 718 mg/l Grass shrimp (palaemonetes) EC100 (96 hr): 1,000 mg/l Mud crab (Neopanopa) EC0 (96 hr): 750 mg/l Mud crab (Neopanopa)

13. DISPOSAL CONSIDERATIONS

<u>PREPARING WASTES FOR DISPOSAL</u>: Waste disposal must be in accordance with appropriate Federal, State, and local regulations. It may be disposed of by treatment at a permitted facility or as advised by your local hazardous waste regulatory authority.

EPA WASTE NUMBER: D002 (Characteristic, corrosive), applicable to wastes consisting only of this solution.

14. TRANSPORTATION INFORMATION

Department of Transportation:

Proper Shipping Name: Paint related material

Class: 8

UN/ID No.: UN3066
Packing Group: III
Marine Pollutant No

IMDG Shipping Data:

Proper Shipping Name: Paint related material

Class: 8

UN/ID No.: UN3066
Packing Group: III
Marine Pollutant: No

IATA Shipping Data:

Proper Shipping Name: Paint related material

 Class:
 8

 UN/ID No.:
 UN3066

 Packing Group:
 III

 Marine Pollutant:
 No

TDG

Proper Shipping Name: Paint related material

Class: 8
UN/ID No.: UN3066
Packing Group: III
Marine Pollutant: No

15. REGULATORY INFORMATION

OCCUPATIONAL SAFETY AND HEALTH ACT (OSHA): This Safety Data Sheet (SDS) has been prepared in compliance with the federal OSHA Hazard Communication Standard 29 DFR 1910.1200

OSHA Hazard Communication Standard (29CFR1910.1200 hazard class (es) - Corrosive, Sensitizer

<u>SARA REPORTING REQUIREMENTS</u>: The components of the product are not subject to the reporting requirements of Sections 304 and 313 of Title III of the Superfund Amendments and Reauthorization Act. Hazard classification: Acute Health Hazard, Chronic Health Hazard.

SARA Threshold Planning Quantity: Not applicable

TSCA INVENTORY STATUS: The components of the product are listed on the TSCA Inventory.

CERCLA REPROTABLE QUANTITY (RQ): None

OTHER FEDERAL REGULATIONS: Not applicable

STATE REGULATORY INFORMATION: Components of this product are covered under specific State regulations, as denoted below:

New Jersey Right-to-know: The following is required composition information:

CAS Number:

112-24-3

112-57-2

Chemical Name:

Triethylenetetramine

Tetraethylenepentamine

RTK No: 1908

1816

Pennsylvania Right-to-know: The following is required composition information:

CAS Number:

112-24-3

112-57-2

Chemical Name:

Triethylenetetramine

Tetraethylenepentamine

CALIFORNIA PROPOSITION 65: Not listed.

WHMIS:

D1B - Poisonous and infectious material - Immediate and serious effects - Toxic

D2B - Poisonous and infectious material - Other effects - Toxic

E - Corrosive material







D1B - Toxic

D2B - Toxi

E - Corrosiv

WHMIS Health Effects Criteria Met by this Chemical:

D1B - Acute lethality - toxic - immediate

D2B - Skin Sensitization - toxic - other

E - Corrosive to skin

E - TDG class 8 - corrosive substance

WHMIS Ingredient Disclosure List: Included for disclosure at 1% or greater

16. OTHER INFORMATION

PREPARED BY: ANDREW WATT

THIS INFORMATION IS DRAWN FROM RECOGNIZED SOURCES BELIEVED TO BE RELIABLE. CROSSFIELD PRODUCTS CORP. MAKES NO GUARANTEES NOR ASSUMES ANY LIABILITY IN CONNECTION WITH THIS INFORMATION. THE USER SHOULD BE AWARE OF CHANGING TECHNOLOGY, RESEARCH, REGULATIONS AND ANALYTICAL PROCEDURES THAT MAY REQUIRE CHANGES HEREIN. THE ABOVE DATA IS SUPPLIED UPON THE CONDITION THAT PERSONS WILL EVALUATE THIS INFORMATION AND THEN DETERMINE ITS SUITABILITY FOR THEIR USE.

DEFINITIONS OF TERMS

A large number of abbreviations and acronyms appear on a MSDS. Some of these which are commonly used include the following:

CAS #: This is the Chemical Abstract Service Number which uniquely identifies each constituent. It is used for computer-related searching.

EXPOSURE LIMITS IN AIR:

ACGIH - American Conference of Governmental Industrial Hygienists, a professional association which establishes exposure limits.

TLV - Threshold Limit Value - an airborne concentration of a substance which represents conditions under which it is generally believed that nearly all workers may be repeatedly exposed without adverse effect. The duration must be considered, including the 8-hour Time Weighted Average (TWA), the 15-minute Short Term Exposure Limit, and the instantaneous Ceiling Level. Skin adsorption effects must also be considered. OSHA - U.S. Occupational Safety and Health Administration.

PEL - Permissible Exposure Limit - This exposure value means exactly the same as a TLV, except that it is enforceable by OSHA. The OSHA Permissible Exposure Limits are based in the 1989 PELs and the June, 1993 Air Contaminants Rule (<u>Federal Register</u>: 58: 35338-35351 and 58: 40191). Both the current PELs and the vacated PELs are indicated. The phrase, "Vacated 1989 PEL," is placed next to the PEL which was vacated by Court Order.

IDLH - Immediately Dangerous to Life and Health - This level represents a concentration from which one can escape within 30-minutes without suffering escape-preventing or permanent injury. The DFG - MAK is the Republic of Germany's Maximum Exposure Level, similar to the U.S. PEL. NIOSH is the National Institute of Occupational Safety and Health, which is the research arm of the U.S. Occupational Safety and Health Administration (OSHA). NIOSH issues exposure guidelines called Recommended Exposure Levels (RELs). When no exposure guidelines are established, an entry of NE is made for reference.

HMIS HAZARD RATINGS:

HAZARDOUS MATERIALS IDENTIFICATION SYSTEM: Health Hazard: 0 (minimal acute or chronic exposure hazard); 1 (slight acute or chronic exposure hazard); 2 (moderate acute or significant chronic exposure hazard); 3 (severe acute exposure hazard; onetime over-exposure can result in permanent injury and may be fatal); **4** (extreme acute exposure hazard; onetime over-exposure can be fatal). <u>Flammability Hazard</u>: **0** (minimal hazard); 1 (materials that require substantial pre-heating before burning); 2 (combustible liquid or solids; liquids with a flash point of 38-93°C [100-200°F]); 3 (Class IB and IC flammable liquids with flash points below 38°C [100°F]); 4 (Class IA flammable liquids with flash points below 23°C [73°F] and boiling points below 38°C [100°F]). Reactivity Hazard: 0 (normally stable); 1 (material that can become unstable at elevated temperatures or which can react slightly with water); 2 (materials that are unstable but do not detonate or which can react violently with water); 3 (materials that can detonate when initiated or which can react explosively with water); 4 (materials that can detonate at normal temperatures or pressures)

NATIONAL FIRE PROTECTION ASSOCIATION: Health Hazard: 0 (material that on exposure under fire conditions would offer no hazard beyond that of ordinary combustible materials); 1 (materials that on exposure under fire conditions could cause irritation or minor residual injury); 2 (materials that on intense or continued exposure under fire conditions could cause temporary incapacitation or possible residual injury); 3 (materials that can on short exposure could cause serious temporary or residual injury); 4 (materials that under very short exposure could cause death or major residual injury). Flammability Hazard and Reactivity Hazard: Refer to definitions for "Hazardous Materials Identification System".

FLAMMABILITY LIMITS IN AIR:

Much of the information related to fire and explosion is derived from the National Fire Protection Association (NFPA). Flash Point - Minimum temperature at which a liquid gives off sufficient vapors to form an ignitable mixture with air. Autoignition Temperature: The minimum temperature required to initiate combustion in air with no other source of ignition. LEL - the lowest percent of vapor in air, by volume, that will explode or ignite in the presence of an ignition source. UEL - the highest percent of vapor in air, by volume, that will explode or ignite in the presence of an ignition source.

TOXICOLOGICAL INFORMATION:

Possible health hazards as derived from human data, animal studies, or from the results of studies with similar compounds are presented. Definitions of some terms used in this section are: LD₅₀ - Lethal Dose (solids & liquids) which kills 50% of the exposed animals; LC₅₀ - Lethal Concentration (gases) which kills 50% of the exposed animals; ppm concentration expressed in parts of material per million parts of air or water; mg/m³ concentration expressed in weight of substance per volume of air; mg/kg quantity of material, by weight, administered to a test subject, based on their body weight in kg. Data from several sources are used to evaluate the cancer-causing potential of the material. The sources are: IARC - the International \underline{A} gency for \underline{R} esearch on \underline{C} ancer; NTP - the \underline{N} ational Toxicology Program, RTECS - the Registry of Toxic Effects of Chemical Substances, OSHA and CAL/OSHA. IARC and NTP rate chemicals on a scale of decreasing potential to cause human cancer with rankings from 1 to 4. Subrankings (2A, 2B, etc.) are also used. Other measures of toxicity include TDLo, the lowest dose to cause a symptom and TCLo the lowest concentration to cause a symptom; TDo, LDLo, and LDo, or TC, TCo, LCLo, and LCo, the lowest dose (or concentration) to cause death. BEI -Biological Exposure Indices, represent the levels of determinants which are most likely to be observed in specimens collected from a healthy worker who has been exposed to chemicals to the same extent as a worker with inhalation exposure to the TLV.

REGULATORY INFORMATION:

This section explains the impact of various laws and regulations on the material. EPA is the U.S. Environmental Protection Agency. WHMIS is the Canadian Workplace Hazardous Materials Information System. DOT and TC are the U.S. Department of Transportation and the Transport Canada, respectively. Other acronyms used are: Superfund Amendments and Reauthorization Act (SARA); the Toxic Substance Control Act (TSCA); Marine Pollutant status according to the DOT; California's Safe Drinking Water Act (Proposition 65); the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA or Superfund); and various state regulations. This section also includes information on the precautionary warnings which appear on the materials package label.